 


## HEALTH & SAFETY ALERT




Genie has become aware that customers, who purchased replacement level sensors for the GS, GR, GRC and QS models, may have received the incorrect level sensor from their European service parts distribution centre.

Using the incorrect level sensor, may cause the tilt alarm to sound at a greater slope rating than what the machine is rated for, resulting in loss of machine stability. Machines affected by this safety notice must be removed from service until the following actions are completed:


- 1. Locate all machines where the level sensors purchased were installed.
- 2. Inspect the level sensor. The correct level sensor must have a red band around the top. If the level sensor has a red band, continue on to step 6. If the level sensor is other than what is described above, the machine must remain out of service.
- 3. Order Genie P/N 105142.
- Replace and test the new level sensor (P/N 823515).

## Genie Scissors models:

- Using the ground controls, raise the platform.
- b. Deploy the safety chock.

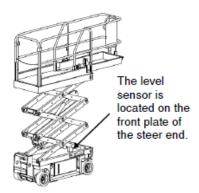

## GR, GRC and QS models:

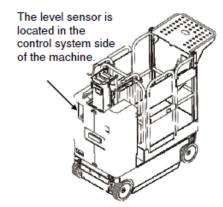

Models Affected
GS-1530
GS-1532
GS-1930
GS-1932
GS-2032
GS-2632
GS-3232
GS-3246
GS-3646
GS-3646
GS-4047
GR
GRC
QS

- 5. Return the machine to service.
- 6. Fill out the completion form and return to Genie. This will verify that you have completed this safety notice.

Please contact your nearest Terex AWP dealer for assistance in completing this safety notice.

For more information on this Safety Notice please visit

http://www.genielift.co.uk/en/sales-and-support/bulletin- campaigns/index.htm

